

Daily Log

search: "ALL" · 15 entries · generated 2026-06-17 06:31

Wednesday, June 10, 2026

Timeon P. · RPL10 · logged 2026-06-10 19:47

GSEF1:

OSE labels colored per path. Some OSE cans will have more than one path, clarity needed on label requirements.

One label per path?(IES)

Horizontal Ladder rack on the West wall needs a 24 inch triangle bracket, and needs to move to 8" from the wall.

(IES)

Dress all OSP cables to the respective OSE. (Mortenson/IES)

Concrete slabs need to be sanded and labeled with placards before splicing can start. (Mortenson)

Possibly paint the slab. (Mortenson)

GSEF2:

OSE labels colored per path. Some OSE cans will have more than one path, clarity needed on label requirements.

One label per path?(IES)

Dress all OSP cables to the respective OSE.(Mortenson/IES)

Concrete slabs need to be sanded and labeled with placards before splicing can start. (Mortenson)

Possibly paint the slab. (Mortenson)

CMDF1:

Awaiting 1 OC to complete rack bonding and grounding. Ordered and in transit (IES)

Concrete slabs need to be sanded and labeled before splicing can start. Possibly paint the slab. (Mortenson)

CMDF2:

Awaiting 1 OC to complete rack bonding and grounding. Ordered and in transit (IES)

Concrete slabs need to be sanded and labeled before splicing can start. Possibly paint the slab. (Mortenson)

GSMDF1:

2x Spill outs needed

Networking Constraints

Missing 10 devices for corpnet and 24 power cords (IBOS)

Waiting 110 of fact net devices and optics (IBOS)

FIM is not updated, Do not have a complete portmap for fiber or copper (ENS)

GSMDF2:

2x Spill outs needed

Networking Constraints

Missing 10 devices for corpnet and 24 power cords (IBOS)

Waiting 110 of fact net devices and optics (IBOS)

FIM is not updated, Do not have a complete portmap for fiber or copper (ENS)

Monday, June 08, 2026

Timeon P. · CMDF2 · logged 2026-06-08 14:55

Label racks

Finished bonding for vertical ladder racks to tier 1

Bonding for racks and finish continuity for overhead ladder rack, bonding does not touch all runway

Monday, June 01, 2026

Timeon P. · GSEF2 · logged 2026-06-01 15:27

Extra vertical ladder rack under tier 2
Overhead support missing for crossover runway.
Missing caps on unistrut
Tier 1 to tier 2 grounding and bonding missing

Timeon P. · CMD1/2 · logged 2026-06-01 15:20

Vertical ladder rack missing.
Racks missing grounding and bonding
Overhead ladder rack missing bonding
Missing ground bar
Unistrut caps missing

Timeon P. · GSEF1 · logged 2026-06-01 15:15

EF one is missing the overhead support for the crossover. Ladder rack on the west wall missing the grounding and bonding. we're also missing the unit strut caps. Ladder rack support on the west wall.
Vertical ladder rack on west wall under tier 2 not needed
Missing ground bar.
Tier 1 to 2 grounding and bonding missing.

Wednesday, May 27, 2026

Caleb Bourghs · NCB RPL10 · logged 2026-05-27 20:57

Qa Team meeting discussing Specifications, upcoming FOK, FOK specifics with photo information, and site walk preparations. Started L2 FOK for GSCMDF1. Completed Tiger Meeting going over GC handovers, cable tray system pathways, and bridges for cable pulling. Completed a site walk with our Supers and DPR. Took notes on all discussed and saved in Teams. Took site photos to complete GSCMDF FOK.

Notes from walk:

Qa GC MDF WALK

CABLE PATHWAY FOR NORTH WALL LOCATION

EPMS LOCATION?

FIBER WILL BE ON TOP OF TRANSITIONS

FOK CABLE SYSTEM PATHWAYS

FIRE ALARM MIDDLE LANE, NEED TO SHIFT AP TO MEET MIN DISTANCE EMI/SPEC

Mdf2, same issue with ap location next to fire alarm.

Extending ap piping to be way from alarm

Swap rack direction rfi CMDF?

NO ANSWER ON RFI YET. POTENTIAL ISSUE BEING CLOSE TO ELECTRICAL BOX

E 1

25% WHEN ROW 5 IS ANCHORED

NEED TO VERIFY ALL ROWS ARE EVEN AND MATCHING MEASUREMENTS BEFORE LAST 2 BOLTS ARE PLACED

Front o base 84 1/2, back to back 77 1/2

ENSURE ALL END CAPS ARE PLACED BEFORE STARTING TO PULL CABLE!

Place end caps while material is on ground.

EGsidf2 - fe needs to arrange Box for outside wap

Exterior cans are hung, need close out with qa

Get fok for external, send to chance

CMDF 2 - FACEPLATES FOR SOUTH WALL

CMDF1 - vertical ladder rack for south wall after cement sets

Tuesday, May 26, 2026

Caleb Bourghs · NCB · logged 2026-05-27 12:20

Created L0s for warehouse inventory, updated tracker. Started FOK for GSCMDF, gathering all specs pertaining to the room.

Friday, May 22, 2026

Caleb Bourghs · WAREHOUSE · logged 2026-05-27 14:51

Created L1s, verified all deliverables on Warehouse floor. Coordinated with Logistics team to move material.

Tuesday, May 19, 2026

Caleb Bourghs · WAREHOUSE · logged 2026-05-20 18:57

Created L1s and updated Qa tracker all day per delivery. 6 truck deliveries for the day

Monday, May 18, 2026

Caleb Bourghs · NCB RPL10 · logged 2026-05-18 21:01

Completed walk and measurements with QA Team for RPL10 EF2. Received notice from DPR about GSCMDF VCMs are too close to the wall to open rack doors for full clearance. Verified our teams are working on it. Returned after lunch to verify clearance, there is enough room for doors to open comfortably. Verified they are still trying to make more room for opening VCM doors. Did RPL10 EF2 site walk with GC, PM, and Supers. Verified our team is bringing all material through RPL10 Gate 2 (Front right gate if your facing rpl10 from trailer city). Completed L1s and edited older L1s adding name and quantity. Updated qa tracker to match L1 forms.

Friday, May 01, 2026

Caleb Bourghs · WAREHOUSE, NCB · logged 2026-05-01 20:20

Went through all material at Warehouse. Verify all material through OOR, receivables, and ACC website. Verified all 554 tWo post racks were fully up to specs and in good condition. Created all templates for our L1 connectivity material

Thursday, April 30, 2026

Caleb Bourghs · RPL10, CMDF1, CMDF2, GSIDFNX5 · logged 2026-04-30 21:54

Started with daily specs, site updates, and team coordination.

CMDF1, CMDF2, IDFNX5 Walk Throughs with QA Team.

Created 2 Issues- Issue #6394: Concrete has a hole on the East Wall 66 1/2 inches from the South wall in CMDF1. Hole is 2 1/2 inches in length and 1 inch wide. Hole is where the first VCM will be located.

Issue #6391: CMDF2 South & West wall vertical ladder rack locations blocked by EPMS/BAS conduit.

Other team members placed 3 other issues today we found in the field during our walk-through.

Verified specs and measurements for our CMDF2 VCMs on-site. All measurements met requirements and standards.

Verified splicing in our IDFNX5. Reported findings to our Super Intendant Chance to contact Clearcore to make needed changes to meet all Splicing specs/Housekeeping.

Timeon P. · GSIDFNX05 · logged 2026-04-30 21:49

Walked CMDF2 and took measurements to ensure that the racks placed were at the correct locations before being anchored. Racks were landed according to prints.

Super Chance informed us about issues he noticed in the field, took pictures and created formal issues in ACC, listed below:

Issue #6395 GSIDFNX05 MOFE Door

Issue #6393 GSIDFNX05 Labeling Conflict

Richard reviewed splice cassette alignment with chance to ensure that they were aligned with the FE labels

Walked the GSIDFNX05 and noticed that Clear Core left fiber clippings on the floor and that the fiber dressing in both the 432 can and the 1u unican fiber enclosure was not up to standard, they were called back to correct the dressing.

Timeon P. · RPL10 GSEF 1/2, CMDF 1/2, IDFNX5 · logged 2026-04-30 18:37

Completed a field walk with the FE team through the GSEF's 1/2, CMDF 1/2, and IDFNX5.

Photos of the temporary 2 post rack in GSEF 1 for the temporary splices were taken. Temp splices of two 192 fibers in IDFNX5 were completed by Clear Core.

SFE Paul informed us that the horizontal ladder runway in both CMDF's will have to move away from their respective walls by approx. 5" to allow for adequate space for the fiber to be routed within the bend radius. The changes will be redlined after installation per Hargis. This will also allow for the horizontal crossovers to be installed with out the overhead support. As the CMDF's have been buildout to spec, the FE's are reviewing to see if this will be a change order.

Tuesday, April 28, 2026

Timeon P. · RPL10.CMDF 1/2 · logged 2026-04-30 12:03

Completed a pre-installation walkthrough of CMDF 1/2. Took measurements of the room and found one issue, that was documented (Issue #5174).